

SOUNDING TEST RESULT

Proyek : Hotel
 Lokasi : Sedan, Sariharjo, Ngaglik, Sleman
 Test No. : Titik -1
 Ground Level : Tanah Setempat
 Ground Water Level : - m


<i>Depth</i> (m)	<i>CR</i> kgf/cm ²	<i>CR+LF</i> kgf/cm ²	<i>LF</i> kgf/cm ²	<i>TF</i> kgf/cm	<i>Total</i> kgf/cm
(1)	(2)	(3)	(4)	(5)	(6)
0	0	0	0	0	0
0.2	0	0	0	0	0
0.4	3	8	0.5	10	10
0.6	5	11	0.6	12	22
0.8	7	13	0.6	12	34
1	10	16	0.6	12	46
1.2	22	28	0.6	12	58
1.4	21	27	0.6	12	70
1.6	83	90	0.7	14	84
1.8	84	88	0.4	8	92
2	35	40	0.5	10	102
2.2	22	27	0.5	10	112
2.4	34	39	0.5	10	122
2.6	33	37	0.4	8	130
2.8	48	53	0.5	10	140
3	74	80	0.6	12	152
3.2	46	51	0.5	10	162
3.4	52	61	0.9	18	180
3.6	51	55	0.4	8	188
3.8	22	27	0.5	10	198
4	26	30	0.4	8	206
4.2	23	27	0.4	8	214
4.4	22	25	0.3	6	220
4.6	18	23	0.5	10	230
4.8	30	35	0.5	10	240
5	32	37	0.5	10	250

5.2	35	40	0.5	10	260
5.4	35	42	0.7	14	274
5.6	40	45	0.5	10	284
5.8	33	39	0.6	12	296
6	75	99	2.4	48	344
6.2	80	84	0.4	8	352
6.4	61	67	0.6	12	364
6.6	50	55	0.5	10	374
6.8	77	85	0.8	16	390
7	110	135	2.5	50	440
7.2	115	130	1.5	30	470
7.4	94	100	0.6	12	482
7.6	110	130	2	40	522
7.8	70	77	0.7	14	536
8	52	58	0.6	12	548
8.2	42	47	0.5	10	558
8.4	20	25	0.5	10	568
8.6	42	48	0.6	12	580
8.8	36	47	1.1	22	602
9	52	58	0.6	12	614
9.2	150	180	3	60	674
9.4	220	235	1.5	30	704
9.6	130	150	2	40	744
9.8	115	125	1	20	764
10	250	280	3	60	824
10.2	310	340	3	60	884
10.4	250	275	2.5	50	934
10.6	160	185	2.5	50	984
10.8	260	280	2	40	1024
11	240	275	3.5	70	1094
11.2	210	245	3.5	70	1164
11.4	150	170	2	40	1204
11.6	155	170	1.5	30	1234
11.8	230	270	4	80	1314
12	225	255	3	60	1374
12.2	215	250	3.5	70	1444
12.4	180	210	3	60	1504
12.6	200	240	4	80	1584
12.8	185	205	2	40	1624

13	230	255	2.5	50	1674
13.2	210	250	4	80	1754
13.4	250	300	5	100	1854
13.6	290	330	4	80	1934
13.8	280	310	3	60	1994
14	335	360	2.5	50	2044
14.2	270	295	2.5	50	2094
14.4	280	305	2.5	50	2144
14.6	230	250	2	40	2184
14.8	220	245	2.5	50	2234
15	160	170	1	20	2254
15.2	170	195	2.5	50	2304
15.4	150	170	2	40	2344
15.6	150	175	2.5	50	2394
15.8	180	200	2	40	2434
16	200	225	2.5	50	2484
16.2	230	260	3	60	2544
16.4	200	200	0	0	2544
16.6	210	220	1	20	2564
16.8	200	230	3	60	2624
17	250	275	2.5	50	2674
17.2	190	230	4	80	2754
17.4	260	290	3	60	2814
17.6	310	340	3	60	2874
17.8	360	390	3	60	2934
18	310	350	4	80	3014
18.2	500	500	0	0	3014

SOUNDING TEST RESULT

Proyek : Hotel
 Lokasi : Sedan, Sariharjo, Ngaglik, Sleman
 Test No. : Titik -1
 Ground Level : Tanah Setempat
 Ground Water Level : - m

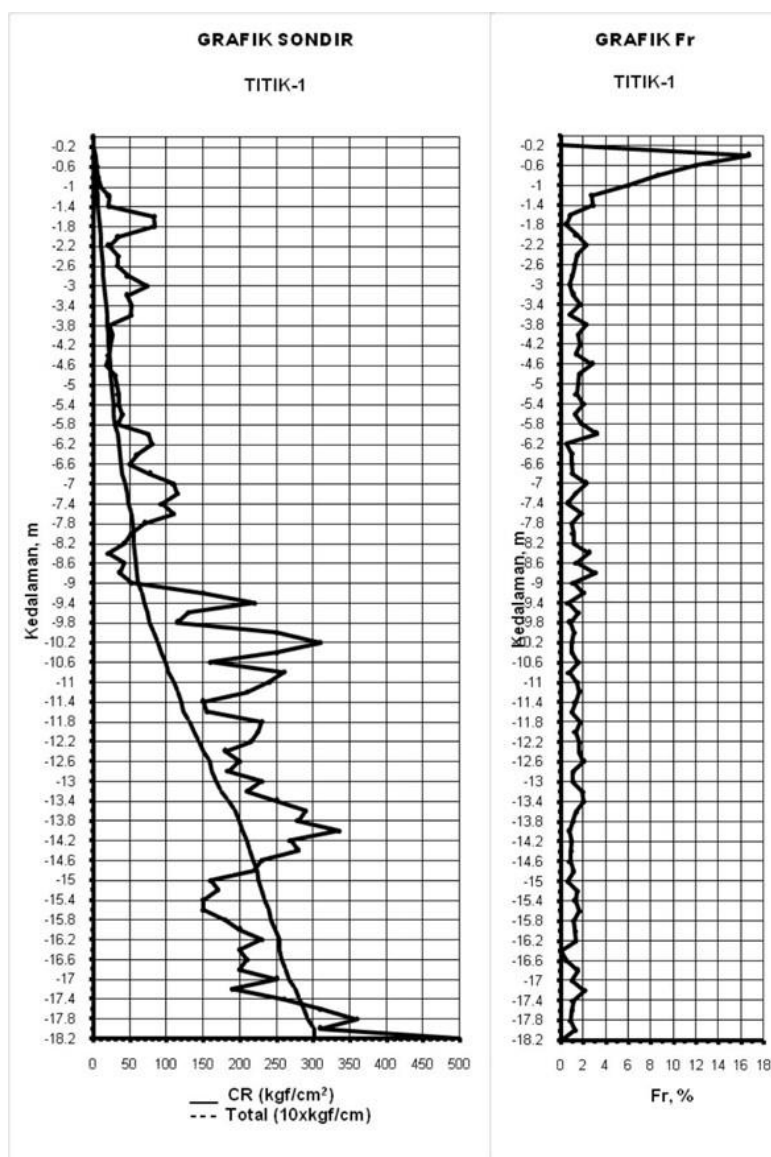

SOUNDING TEST RESULT

Proyek : Hotel
 Lokasi : Sedan, Sariharjo, Ngaglik, Sleman
 Test No. : Titik -2
 Ground Level : Tanah Setempat
 Ground Water Level : - m

<i>Depth</i> (m)	<i>CR</i> kgf/cm ²	<i>CR+LF</i> kgf/cm ²	<i>LF</i> kgf/cm ²	<i>TF</i> kgf/cm	<i>Total</i> kgf/cm
(1)	(2)	(3)	(4)	(5)	(6)
0	0	0	0	0	0
0.2	0	0	0	0	0
0.4	12	17	0.5	10	10
0.6	10	15	0.5	10	20
0.8	7	11	0.4	8	28
1	12	15	0.3	6	34
1.2	23	26	0.3	6	40
1.4	18	22	0.4	8	48
1.6	20	24	0.4	8	56
1.8	21	25	0.4	8	64
2	25	30	0.5	10	74
2.2	42	48	0.6	12	86
2.4	47	52	0.5	10	96
2.6	40	44	0.4	8	104
2.8	41	46	0.5	10	114
3	60	65	0.5	10	124
3.2	79	86	0.7	14	138
3.4	56	63	0.7	14	152
3.6	103	111	0.8	16	168
3.8	98	105	0.7	14	182
4	46	55	0.9	18	200
4.2	30	35	0.5	10	210
4.4	25	30	0.5	10	220
4.6	21	25	0.4	8	228
4.8	22	27	0.5	10	238
5	23	28	0.5	10	248
5.2	25	30	0.5	10	258
5.4	24	31	0.7	14	272

5.6	38	45	0.7	14	286
5.8	40	45	0.5	10	296
6	110	145	3.5	70	366
6.2	160	175	1.5	30	396
6.4	170	200	3	60	456
6.6	50	57	0.7	14	470
6.8	40	46	0.6	12	482
7	31	35	0.4	8	490
7.2	34	40	0.6	12	502
7.4	28	33	0.5	10	512
7.6	17	25	0.8	16	528
7.8	19	24	0.5	10	538
8	24	36	1.2	24	562
8.2	40	45	0.5	10	572
8.4	44	50	0.6	12	584
8.6	66	70	0.4	8	592
8.8	78	81	0.3	6	598
9	45	56	1.1	22	620
9.2	22	28	0.6	12	632
9.4	22	25	0.3	6	638
9.6	46	50	0.4	8	646
9.8	90	94	0.4	8	654
10	80	85	0.5	10	664
10.2	77	81	0.4	8	672
10.4	118	121	0.3	6	678
10.6	133	145	1.2	24	702
10.8	160	170	1	20	722
11	145	170	2.5	50	772
11.2	165	185	2	40	812
11.4	110	140	3	60	872
11.6	125	150	2.5	50	922
11.8	155	170	1.5	30	952
12	180	210	3	60	1012
12.2	200	230	3	60	1072
12.4	110	135	2.5	50	1122
12.6	190	210	2	40	1162
12.8	220	250	3	60	1222
13	240	270	3	60	1282
13.2	280	330	5	100	1382

13.4	250	280	3	60	1442
13.6	210	260	5	100	1542
13.8	310	340	3	60	1602
14	200	240	4	80	1682
14.2	250	265	1.5	30	1712
14.4	265	285	2	40	1752
14.6	245	260	1.5	30	1782
14.8	240	255	1.5	30	1812
15	200	230	3	60	1872
15.2	190	220	3	60	1932
15.4	200	215	1.5	30	1962
15.6	170	182	1.2	24	1986
15.8	185	195	1	20	2006
16	220	240	2	40	2046
16.2	210	234	2.4	48	2094
16.4	250	272	2.2	44	2138
16.6	230	250	2	40	2178
16.8	220	240	2	40	2218
17	240	265	2.5	50	2268
17.2	200	220	2	40	2308
17.4	250	275	2.5	50	2358
17.6	280	300	2	40	2398
17.8	290	310	2	40	2438
18	230	250	2	40	2478
18.2	310	340	3	60	2538
18.4	330	355	2.5	50	2588
18.6	350	375	2.5	50	2638
18.8	500	500	0	0	2638

SOUNDING TEST RESULT

Proyek : Hotel
 Lokasi : Sedan, Sariharjo, Ngaglik, Sleman
 Test No. : Titik -2
 Ground Level : Tanah Setempat
 Ground Water Level : - m

